

# Product Information Notice

**Models:** Greenstar Combi 151p (7738100611)

**Subject:** Incorrect Hydraulic Connection Plate



**BOSCH**

## Summary:

A limited amount of Greenstar Combi 151p boilers were packaged with a hydraulic connection plate (p/n: 87186616160) containing incorrect connection fittings. These connections are not NPT and will not properly connect to the boiler (see fig2.)

Affected units were produced between April 2017 and May 2017 and contain a serial number with the date code "720" and "753".

Example SN: 3730-720-003201-8737707071

The boiler serial number is located on top of the packaging box or on the inside of the boiler (see fig1.)

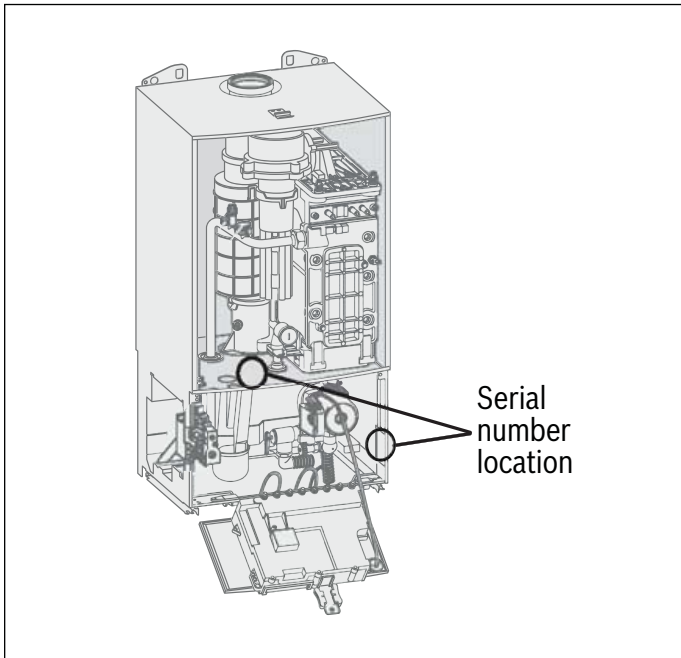


Figure 1

The issue has been corrected at the factory and all subsequent shipments contain the correct hydraulic connection plate.

## Field Action:

If a customer has an affected unit, please contact Bosch customer support for a replacement hydraulic connection plate or to return uninstalled product in inventory for rework.



Figure 2

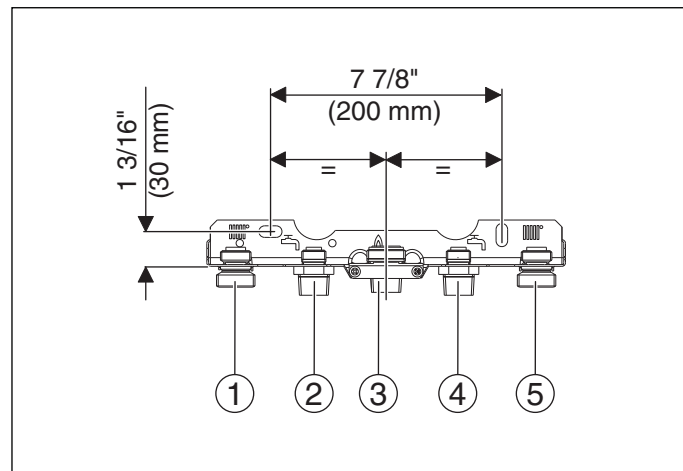


Figure 3 Correct hydraulic connection plate dimensions

- [1] Heating supply, R 1" NPT
- [2] DHW, R 3/4" NPT
- [3] Gas, R 3/4" NPT
- [4] Cold water, R 3/4" NPT
- [5] Heating return, R 1" NPT